REGISTER OF DEEDS OFFICE
ONEIDA COUNTY, WIS.

FILED

MAY 15 2009

At ____ O'Clock ____ M

THOMAS H. LEIGHTON
REGISTER OF DEEDS

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

Note: This form is intended and designed to fulfill all requirements of the Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added if necessary to conform with said requirements.

(a) CORNER LOCATION:

North quarter corner of Section 7
Township 38 North
Range 4 East
Town of Minocqua
County of Oneida

O. C. COORDINATES

North: 225339.2763
East: 104835.3797
Control Station: O. C. 207
Latitude: 45°49'03.59887" N
Longitude: 89°56'30.36164" W
Datum: NAD-83 (91)
Method: Direct RTK - GPS

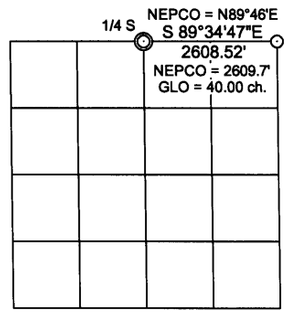

SECTION 7

(b) HISTORY OF ORIGINAL CORNER ESTABLISHMENT

Original Surveyor: Alex Anderson, Deputy Surveyor
Date of Survey: Commenced April 26th, 1865
Completed May 8th, 1865

Original B.T.'s: Hemlock 10" S55°E, 18 links (11.88 feet)
Fir 6" N38°E, 18 links (11.88 feet)

(f)(g)(h) DESCRIPTION OF MONUMENT FOUND AT THIS CORNER AND IF IT WAS ACCEPTED, STATE ALL EVIDENCE (MATERIAL, TESTIMONIAL, OCCUPATIONAL, PLATS, RECORDS, OTHER MONUMENTS) USED AS A BASIS FOR ESTABLISHING LOCATION. IF NOT ACCEPTED OF IF NOTHING WAS FOUND, STATE EVIDENCE USED AS BASIS FOR ESTABLISHING LOCATION. IF REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS, INDICATE ALL MONUMENTS, DISTANCES AND DIRECTIONS USED TO ESTABLISH. INDICATE TYPE OF MONUMENT AND SIGN POST FOUND OR SET.

November 11th, 1937 - Ray H. Hall, Surveyor - CC Camp 75S Book 9, pages 9 & 10 - Set new cedar post by rec. course & distance from Hem. stp. now fallen apart but which bears axe notch in rotted shell. Old cruiser's mark old blazes and pencil record all testify. Cor. is on N. end of a spot of hard land. Var. 0° {Orig. Hem. S54°E, .18 ch. (11.88 feet); Orig. ? Fir N55°E, .18 ch. (11.88 feet); New Cedar 7" N48°W, .349 ch. (23. 03 feet).

February 4, 1989 - Nekoosa Papers Inc. map by W. H. Stuth, for survey performed in 1961 - legends corner "BY OTHERS" and shows bearing and distance tie to the northeast corner of Section 7 as shown above in section diagram.

May 9th, 2009 - James D. Rein, PLS #1234 - Recovered old 3" square cedar post extending 20" above ground level and leaning northerly. I find a second old post point along side buried in mud of beaver flowage. Hall's 7" Cedar matching record is wind thrown and rotted. I replace the wood post with a capped 2.4' o.d. x 30" long flange bottom aluminum monument extending 10" above ground level and reset the wood post 3/4 foot north of the corner monument. I set a white poly stake one foot south of the corner monument and make new bearing trees, marked "BT", as shown below in plan. The corner is located, as described in Hall's record, on an area of upland that has been inundated by a beaver dam and shows sign of a devastating 20+ year old wind storm.

(c)(d)(e) PLAN VIEW OF CORNER WITH TIES TO AT LEAST 4 WITNESS MONUMENTS. IF IN DISAGREEMENT WITH PREVIOUSLY ESTABLISHED CORNER, SHOW THE DISTANCE BETWEEN THE TWO CORNERS AND ALSO INDICATE THE TIES TO THE DISPUTED CORNER.

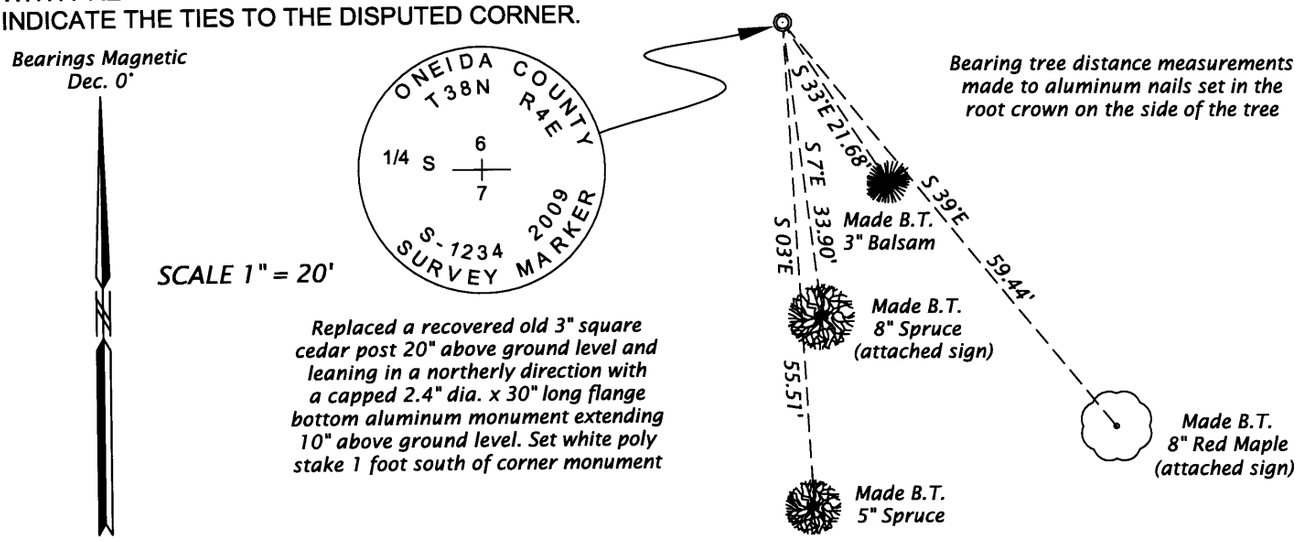

(i) I, JAMES D. REIN, REGISTERED LAND SURVEYOR NO. S-1234 HEREBY CERTIFY THAT THE CORNER LOCATION ON THIS RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

SIGNATURE

May 12, 2009
DATE 38040600020

WISCONSIN
JAMES D. REIN
S-1234
MINOCQUA, WI
LAND SURVEYOR

INDEX NO. E-3