

U.S. PUBLIC LAND SURVEY MONUMENT RECORD


NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7 .08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added if necessary to conform with said requirements.

(a) Corner location: Township 38 North

Range 11 East

Town of Three Lakes

County of Oneida

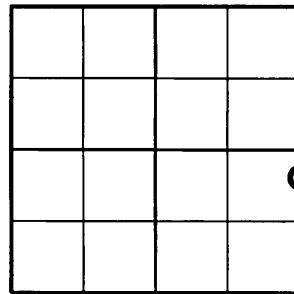

Section 12



(b)(f)(g)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupation, plats, records, other monuments) used as a basis for accepting. If not accepted or if nothing was found, state evidence used as a basis for establishing location. If reestablished through lost corner proportionate methods, indicate all monuments, distances and directions used to establish. Indicate type of monument found or set and sign post.

1858: Alfred Millard Set Original Post.

1937: Wesson Cook performed a dependent resurvey.—29.94 chains set a G.L.O. concrete monument 24 inches long, 6 inches in diameter, 22 inches in the ground with a brass cap — Bearing Trees: 11" Hemlock, S46 3/4°E, 45 links (29.70'), 10" White Pine, S54 1/4°W, 59 links (38.94').

October 9, 1986: James R. Grothman visited corner and found G.L.O monument and accessories in place and in good condition. He found bearing trees: 15" Hemlock, S46°E, 29.70 feet, 14" White Pine, 38.94 feet and set new Bearing Trees: 29" White Pine, S07°W, 16.70 feet, NW corner of concrete foundation of 8'x16' shed, S58°E, 23.73 feet.

October 10, 1988: Milo E. Stefan visited corner and found G.L.O. monument 0.38 chains northerly in Lake Julia and found both bearing trees in good condition. The monument had been moved by activity along the shore and it was 1.53 feet too far Southerly as pulled from the bearing trees. He reset the G.L.O. monument in it's proper location as pulled from the two 1937 bearing trees and set a steel sign post and made one new bearing object: Northwest corner of Boat House, S52°E, 25.08 feet, 6' steel sign post was also set 2.3 feet West.

February 11, 2005: Matthew E. Hoglund visited the corner and found the 1937 bearing trees along with the 1986 bearing tree and the Northwest foundation corner of the shed in good condition. We did not find G.L.O. monument. We set a 3/4" by 24" iron rebar (due to the frost at the time of survey.) using the bearing trees and the foundation corner at the historical corner location. As the original position was in the lakebed and was continually being disturbed, we set a new Meander Corner, a 3/4" iron rebar 24.89 feet Southerly along the section line, so it won't get disturbed. We pulled new bearing and distances to this corner and set new witness corners as shown on Sheet 2 hereof.

(c)(d)(e) Plan view of corner with ties to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed corner.

See Sheet 2

REGISTER OF DEEDS OFFICE
ONEIDA COUNTY, WIS.

APR 7 2008

At _____ O'Clock _____ M
THOMAS H. LEIGHTON
REGISTER OF DEEDS

(i) I, Matthew E. Hoglund, certify that the corner location on this record was determined by me under my direction and control and that this U.S. Public Land Survey Monument is correct and complete to the best of my knowledge and belief.

Signature _____ Date 4/8/2005

Sheet 1 of 2

WITNESS INC

3811121500
3811121400

Index No. G,H 25

